

Manhole Inspection Summary

Manhole # S03EE_001MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **03EE** Node: **001** Status: **Found**

Insp Date: **3/7/08 11:10 AM**

Incomplete Comments

Crew: **ET WJ**
Inspector: **Torres**
Firm: **URS**

Location Address: **4700 N FRANKLINTOWN RD**

Cross Street: **WEATHERDSVILLE RD**

Manhole Type: **Inline** Location: **Woods**

Ground Conditions: **Dry**

☒ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☒ Bolted ☐ Vented ☐ Water Tight ☒ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☒ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☒ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☒ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☒ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View



Defect 2

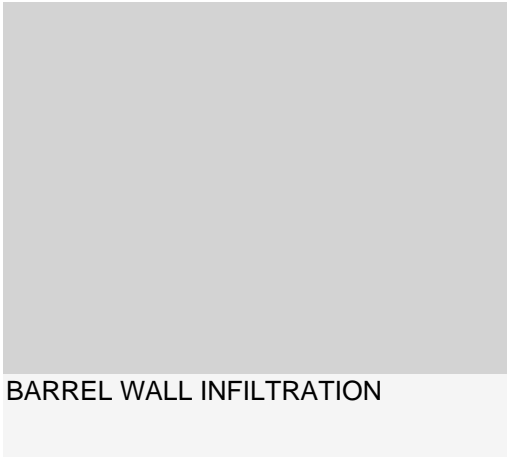

BARREL WALL INFILTRATION

Defect 2



PIPE SEAL INFILTRATION

Manhole Inspection Summary

Manhole # S03EE_001MH

Printed On: 6/24/2010

Page 3 of 3

18 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



PIPE SEAL INFILTRATION

Pipe Height: **18** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☒ Pipe Lined

Invert Depth: **10.80** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

18 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **18** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☒ Pipe Lined

Invert Depth: **10.70** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection